#### **Product data sheet**


## Subminiature connectors




Product description M9 IP40 cable connector, Contacts: 3, 3.0 - 4.0 mm, shielding is not possible, solder, IP40

Area **M9 IP40 series 711**Order number **99 0075 100 03** 



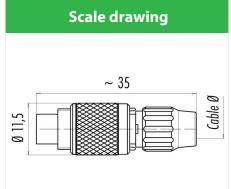

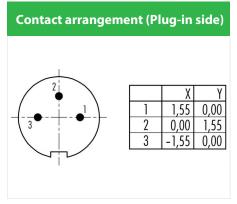

## You can find the component part drawing on the next page.

# **Technical data**

### **General values**

Connector design
Connector locking system
Termination
Wire gauge (mm)
Wire gauge (AWG)
Cable outlet
Upper limit temperature
Lower limit temperature
Customs tariff number
Packaging Unit

cable connector screw solder max. 0.25 mm<sup>2</sup> max. 24 3.0 - 4.0 mm 85 °C - 40 °C 85369010 100

### **Electrical values**

Rated current (40 °C) 4 A 125 V Rated voltage Rated impulse voltage 1500 V Pollution degree Overvoltage category Ш Insulating material group  $\geq 10^{10}\,\Omega$ Insulation resistance EMC compliance shielding is not possible Degree of protection Mechanical operation > 500 Mating cycles

## **Material**

Contact material Contact plating Contact body material Housing material Locking material REACH SVHC CuZn (brass)
Au (gold)
PA (UL94 V-0)
PA
CuZn (Brass nicke,I plated)

CAS 7439-92-1 (Lead)


## **Product data sheet**

# Subminiature connectors



Product description M9 IP40 cable connector, Contacts: 3, 3.0 - 4.0 mm, shielding is not possible, solder, IP40

Area **M9 IP40 series 711** Order number **99 0075 100 03** 

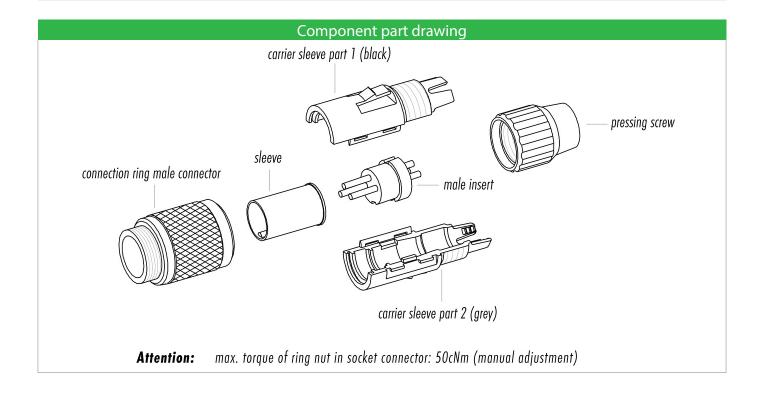

#### **Product data sheet**

## Subminiature connectors



Product description M9 IP40 cable connector, Contacts: 3, 3.0 - 4.0 mm, shielding is not possible, solder, IP40

Area M9 IP40 series 711
Order number 99 0075 100 03

### Security notices

The connector must not be connected or separated under load. Non-observance and incorrect use can result in personal injury.

The connectors are designed for use in plant, control system and electrical equipment. The end user is responsible for checking whether the connectors are suitable for use in other applications.

Connectors used in electrical circuits containing hazardous life parts must only be assembled and used by or under the supervision of persons with the requisite electrotechnical training, taking the applicable regulations and standards into account.

To lock the cable connector to the equipment connector, the threaded ring is tightened until it is 'finger-tight' (approx. 50 cNm).