


Product description	<b>Push-Pull cable connector, Contacts: 19, 4.0 - 8.0 mm, shieldable, solder, IP67</b>
Area	<b>Push-Pull series 440</b>
Order number	<b>99 4841 00 19</b>


### Illustration



### Scale drawing

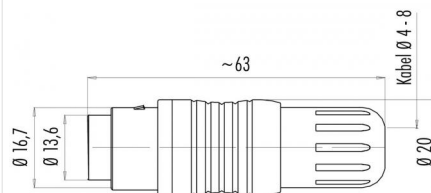

### Contact arrangement (Plug-in side)



	X	Y
A	-2,50	-4,00
B	-4,00	-2,25
C	-4,25	0,00
D	-4,00	2,40
E	-2,30	4,00
F	0,00	4,25
G	2,30	4,00
H	4,00	2,40
I	4,25	0,00
K	4,00	-2,25
L	2,50	-4,00
M	-0,95	-2,40
N	-2,40	-0,95
O	-2,40	0,95
P	-0,95	2,40
R	0,95	2,40
S	2,40	0,95
T	2,40	-0,95
U	0,95	-2,40

**You can find the component part drawing and assembly instructions on the next page.**

## Technical data

### General values

Connector design	cable connector
Connector locking system	Push-Pull
Termination	solder
Wire gauge (mm)	max. 0.25 mm <sup>2</sup>
Wire gauge (AWG)	max. 24
Cable outlet	4.0 - 8.0 mm
Upper limit temperature	85 °C
Lower limit temperature	- 40 °C
Customs tariff number	85369010
Packaging Unit	50

### Electrical values


Rated current (40 °C)	3 A
Rated voltage	60 V
Rated impulse voltage	500 V
Pollution degree	1
Overvoltage category	I
Insulating material group	III
Insulation resistance	≥ 10 <sup>10</sup> Ω
EMC compliance	shieldable
Degree of protection	IP67
Mechanical operation	> 1000 Mating cycles

### Material

Contact material	CuZn (brass)
Contact plating	Au (gold)
Contact body material	PBT (UL94 V-0)
Housing material	PA GF 25
REACH SVHC	CAS 7439-92-1 (Lead)


Product description	<b>Push-Pull cable connector, Contacts: 19, 4.0 - 8.0 mm, shieldable, solder, IP67</b>
Area	<b>Push-Pull series 440</b>
Order number	<b>99 4841 00 19</b>

## Component part drawing

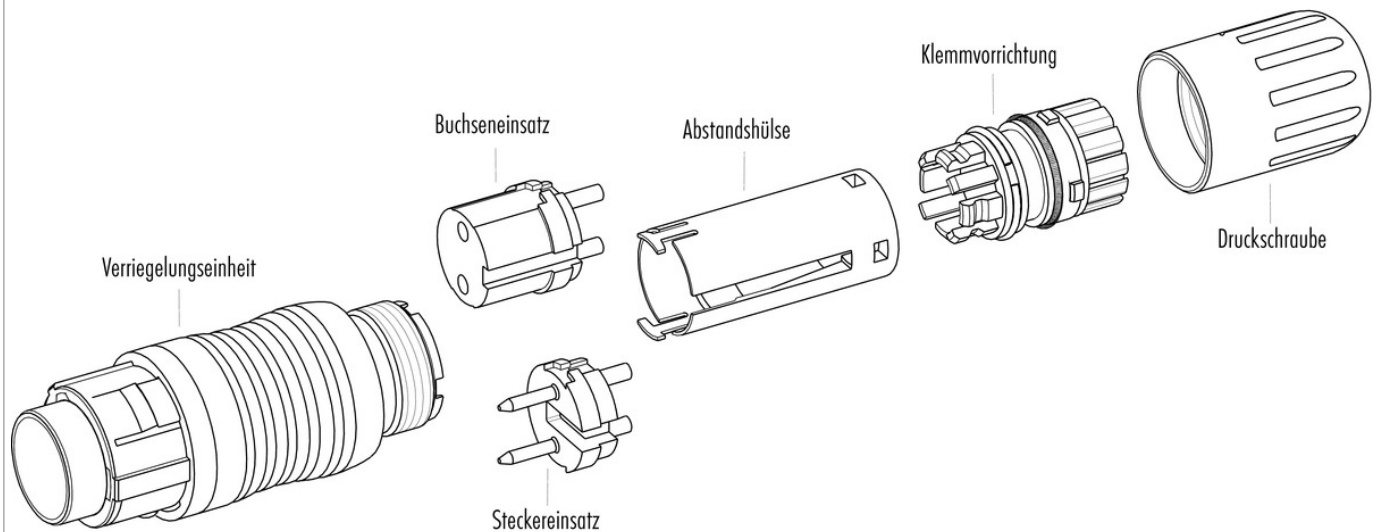

## Assembly instructions / Panel cut-out

1. Abmonteln auf L = 33mm.  
Umarmung nicht abstellen.
2. Druckschraube und Klemmvorrichtung aufstecken. Umarmung entfernen.
3. Litzen abisolieren und verzinnen.
4. Abschirmung aufschneiden und ausklappen. Die Abschirmung in der Krone runden einfügen.
5. Abstandshülse und Klemmvorrichtung verschieben.
6. Gesteckte Einheit nach hinten über Kabel schieben (ca. 10mm).
7. Einsätze anlöten.
8. Gesteckte Einheit nach vorne schieben bis sie in den Kontaktsitz einrastet.
9. Abschirmung in Richtung Abschirmung abstreifen und kürzen.
10. Montierte Einheit in Tügelhülse stecken und Druckschraube festziehen.

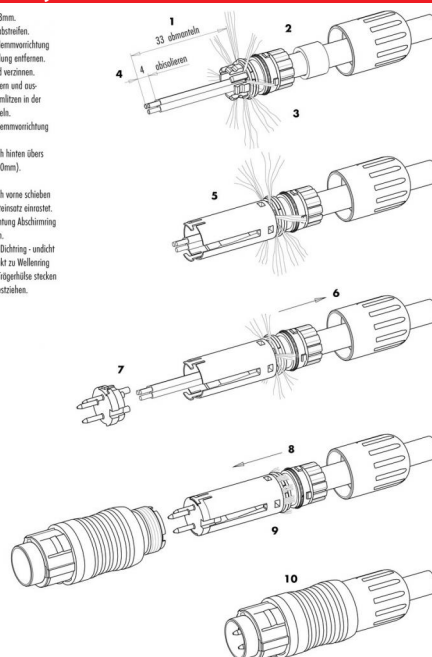

Product description	<b>Push-Pull cable connector, Contacts: 19, 4.0 - 8.0 mm, shieldable, solder, IP67</b>
Area	<b>Push-Pull series 440</b>
Order number	<b>99 4841 00 19</b>

## Security notices

The connectors are designed for use in plant, control system and electrical equipment. The end user is responsible for checking whether the connectors are suitable for use in other applications. Connectors with degree of protection IP 67 and IP 68 are not suitable for use under water. When used outdoors, the connectors must be separately protected against corrosion. For further information about IP degrees of protection refer to 'Technical support' in the Download Centre.