### **Product data sheet**


### Miniature connectors




Product description M16 IP67 female cable connector, Contacts: 19, 4.1 - 7.8 mm, shielding is not possible, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5462 40 19** 

# Illustration

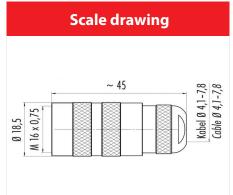

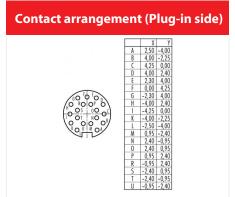

You can find the component part drawing and assembly instructions on the next page.

## **Technical data**

### **General values**

Connector design
Connector locking system
Termination
Wire gauge (mm)
Wire gauge (AWG)
Cable outlet
Upper limit temperature
Lower limit temperature
Customs tariff number
Packaging Unit

### **Cable data**

Approval 1

female cable connector screw solder max. 0.25 mm<sup>2</sup> max. 24

max. 24 4.1 - 7.8 mm 95 °C - 30 °C 85369010 40

UL

### **Electrical values**

Rated current (40 °C)
Rated voltage
Rated impulse voltage
Pollution degree
Overvoltage category
Insulating material group
Insulation resistance
EMC compliance
Degree of protection
Mechanical operation

### Material

Contact material Contact plating Contact body material REACH SVHC > 500 Mating cycles

CuSn (bronze)

CAS 7439-92-1 (Lead)

shielding is not possible

3 A

60 V

500 V

 $\geq 10^{10} \, \Omega$ 

Au (gold) PBT (UL94 V-0)


### **Product data sheet**

### Miniature connectors



Product description M16 IP67 female cable connector, Contacts: 19, 4.1 - 7.8 mm, shielding is not possible, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5462 40 19** 

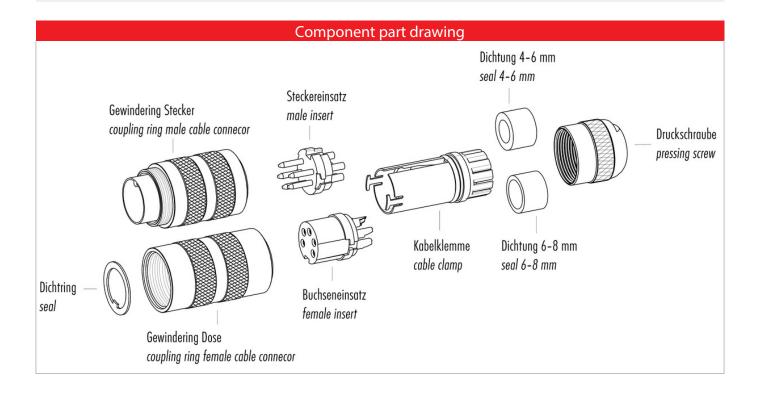

# Assembly instructions / Panel cut-out

### **Gerade Version**


(Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

### Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

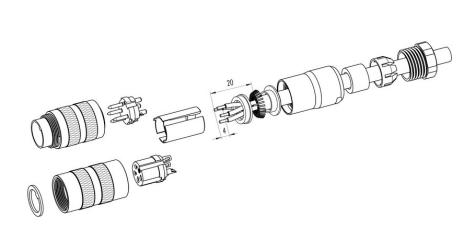



### **Product data sheet**

### Miniature connectors



Product description M16 IP67 female cable connector, Contacts: 19, 4.1 - 7.8 mm, shielding is not possible, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5462 40 19** 

### Security notices

The connectors are designed for use in plant, control system and electrical equipment. The end user is responsible for checking whether the connectors are suitable for use in other applications.

Connectors with degree of protection IP 67 and IP 68 are not suitable for use under water. When used outdoors, the connectors must be separately protected against corrosion. For further information about IP degrees of protection refer to 'Technical support' in the Download Centre.

To lock the cable connector to the equipment connector, the threaded ring is tightened until it is 'finger-tight' (approx. 50 cNm).