#### **Product data sheet**


# Miniature connectors




Product description M16 IP67 male angled connector, Contacts: 19, 6.0 - 8.0 mm, shieldable, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5661 75 19** 



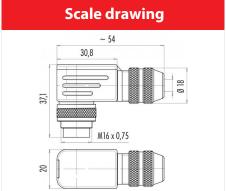

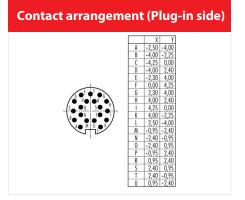

You can find the component part drawing and assembly instructions on the next page.

# **Technical data**

### **General values**

Connector design
Connector locking system
Termination
Wire gauge (mm)
Wire gauge (AWG)
Cable outlet
Upper limit temperature
Lower limit temperature
Customs tariff number
Packaging Unit

#### **Cable data**

Approval 1

male angled connector screw solder max. 0.25 mm<sup>2</sup> max. 24 6.0 - 8.0 mm 95 °C - 30 °C 85369010

20

UL

ector

Rated voltage
Rated impulse voltage
Pollution degree
Overvoltage category
Insulating material group
Insulation resistance
EMC compliance
Degree of protection
Mechanical operation

Rated current (40 °C)

**Electrical values** 

Material

Contact material Contact plating Contact body material REACH SVHC

3 A 60 V 500 V 1 I III  $\geq 10^{10} \Omega$  shieldable

IP67> 500 Mating cycles

CuZn (brass) Au (gold) PBT (UL94 V-0) CAS 96-45-7 (Imidazolidine-2-thione)

CAS 7439-92-1 (Lead)


#### **Product data sheet**

# Miniature connectors



Product description M16 IP67 male angled connector, Contacts: 19, 6.0 - 8.0 mm, shieldable, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5661 75 19** 

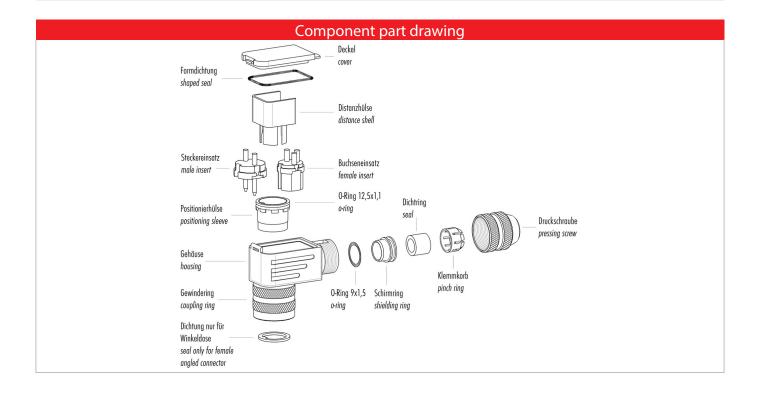

#### Assembly instructions / Panel cut-out Winkelversion 1. Dichtungen montieren (3x). 2. Kabelteile auffädeln. 3. Kabel und Schirm abmanteln. 4. Litzen durch das Gehäuse fädeln. 5. Schirmring, Klemmkorb montieren. 6. Druckschraube leicht andrehen. 7. Litzen an Kontakteinsatz löten. 8. Verdrehhülse in Winkelstellung montieren. 9. Kontakteinsatz, Distanzhülse einsetzen. 10. Deckel einhaken. 11. Druckschraube festziehen (100 cNm). Angled version 1. Assemble sealing rings (3x). 2. Bead cable parts. 3. Dismantle cable and shielding braid. 4. Push single wires through housing. 5. Mount shielding ring and pinch ring. 6. Slightly fix pressing screw. 7. Solder wires to insert. 8. Mount positioning sleeve in angled position. 9. Put in insert and distance sleeve. 10. Mount lid. 11. Fix pressing screw (100 cNm).



### **Product data sheet**

# Miniature connectors



Product description M16 IP67 male angled connector, Contacts: 19, 6.0 - 8.0 mm, shieldable, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5661 75 19** 

## Security notices

The connectors are designed for use in plant, control system and electrical equipment. The end user is responsible for checking whether the connectors are suitable for use in other applications.

Connectors with degree of protection IP 67 and IP 68 are not suitable for use under water. When used outdoors, the connectors must be separately protected against corrosion. For further information about IP degrees of protection refer to 'Technical support' in the Download Centre.

To lock the cable connector to the equipment connector, the threaded ring is tightened until it is 'finger-tight' (approx. 50 cNm).