
# **Product data sheet** Subminiature connectors



Product description

M9 IP40 female cable connector, Contacts: 5, 4.0 - 5.0 mm, shielding is not possible, solder, IP40

Area Order number M9 IP40 series 711 99 0096 102 05

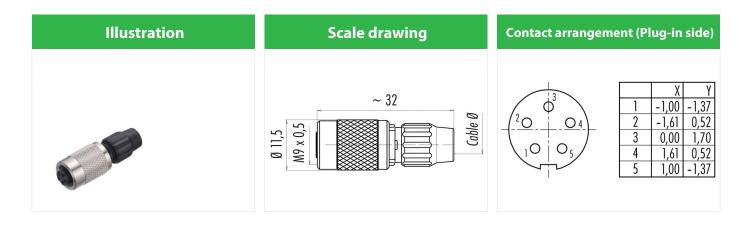

### You can find the component part drawing on the next page.

### **Technical data**

#### **General values**

Connector design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper limit temperature Lower limit temperature Customs tariff number Packaging Unit female cable connector screw solder max. 0.25 mm<sup>2</sup> max. 24 4.0 - 5.0 mm 85 ℃ - 40 ℃ 85369010 100

### **Electrical values**

Rated current (40 °C) Rated voltage Rated impulse voltage Pollution degree Overvoltage category Insulating material group Insulation resistance EMC compliance Degree of protection Mechanical operation

#### **Material**

Contact material Contact plating Contact body material Housing material Locking material REACH SVHC 3 A 125 V 1500 V 1 II II  $\geq 10^{10} \Omega$ shielding is not possible IP40 > 500 Mating cycles

CuSn (bronze) Au (gold) PA (UL94 V-0) PA CuZn (Brass nicke,I plated) CAS 7439-92-1 (Lead)


# **Product data sheet** Subminiature connectors



Product description

M9 IP40 female cable connector, Contacts: 5, 4.0 - 5.0 mm, shielding is not possible, solder, IP40

Area Order number M9 IP40 series 711 99 0096 102 05

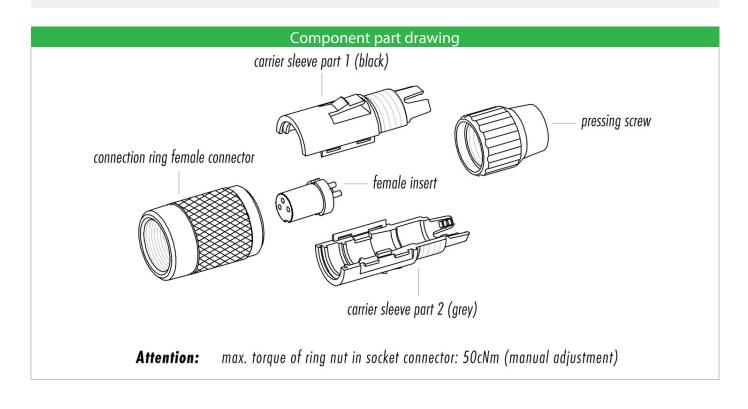

# **Product data sheet** Subminiature connectors



Product description

M9 IP40 female cable connector, Contacts: 5, 4.0 - 5.0 mm, shielding is not possible, solder, IP40

Area Order number M9 IP40 series 711 99 0096 102 05

### Security notices

The connector must not be connected or separated under load. Non-observance and incorrect use can result in personal injury.

The connectors are designed for use in plant, control system and electrical equipment. The end user is responsible for checking whether the connectors are suitable for use in other applications.

Connectors used in electrical circuits containing hazardous life parts must only be assembled and used by or under the supervision of persons with the requisite electrotechnical training, taking the applicable regulations and standards into account.

To lock the cable connector to the equipment connector, the threaded ring is tightened until it is 'finger-tight' (approx. 50 cNm).