#### **Product data sheet**


# Miniature connectors




Product description M16 IP67 female angled connector, Contacts: 14, 4.0 - 6.0 mm, shieldable, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5452 75 14** 



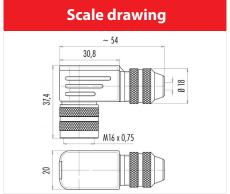

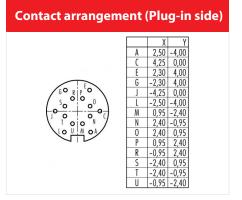

You can find the component part drawing and assembly instructions on the next page.

# **Technical data**

### **General values**

Connector design
Connector locking system
Termination
Wire gauge (mm)
Wire gauge (AWG)
Cable outlet
Upper limit temperature
Lower limit temperature
Customs tariff number
Packaging Unit

#### **Cable data**

Approval 1

female angled connector screw solder max. 0.25 mm<sup>2</sup> max. 24 4.0 - 6.0 mm 95 °C - 30 °C

- 30 °C 85369010 20

#### ral 1

UL

### **Electrical values**

Rated current (40 °C) 3 A Rated voltage 60 V Rated impulse voltage 500 V Pollution degree Overvoltage category Insulating material group Ш  $\geq 10^{10} \, \Omega$ Insulation resistance EMC compliance shieldable Degree of protection IP67 > 500 Mating cycles Mechanical operation

#### Material

Contact material Contact plating Contact body material REACH SVHC CuSn (bronze) Au (gold) PBT (UL94 V-0) CAS 96-45-7 (Imidazolidine-2-thione) CAS 7439-92-1 (Lead)


#### **Product data sheet**

# Miniature connectors



Product description M16 IP67 female angled connector, Contacts: 14, 4.0 - 6.0 mm, shieldable, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5452 75 14** 

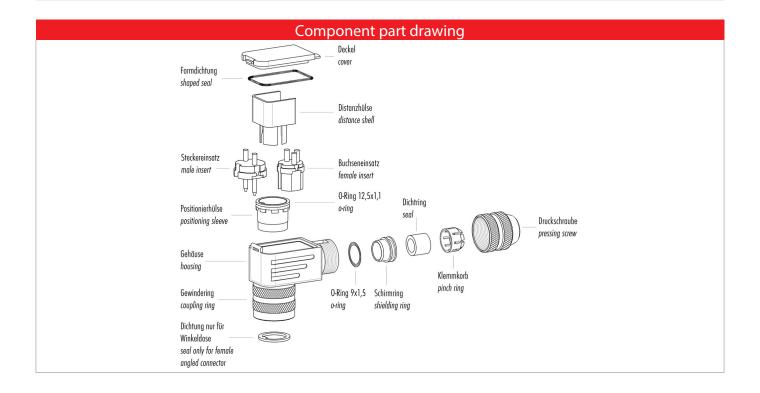

#### Assembly instructions / Panel cut-out Winkelversion 1. Dichtungen montieren (3x). 2. Kabelteile auffädeln. 3. Kabel und Schirm abmanteln. 4. Litzen durch das Gehäuse fädeln. 5. Schirmring, Klemmkorb montieren. 6. Druckschraube leicht andrehen. 7. Litzen an Kontakteinsatz löten. 8. Verdrehhülse in Winkelstellung montieren. 9. Kontakteinsatz, Distanzhülse einsetzen. 10. Deckel einhaken. 11. Druckschraube festziehen (100 cNm). Angled version 1. Assemble sealing rings (3x). 2. Bead cable parts. 3. Dismantle cable and shielding braid. 4. Push single wires through housing. 5. Mount shielding ring and pinch ring. 6. Slightly fix pressing screw. 7. Solder wires to insert. 8. Mount positioning sleeve in angled position. 9. Put in insert and distance sleeve. 10. Mount lid. 11. Fix pressing screw (100 cNm).



### **Product data sheet**

# Miniature connectors



Product description M16 IP67 female angled connector, Contacts: 14, 4.0 - 6.0 mm, shieldable, solder, IP67, UL

Area **M16 IP67 series 423**Order number **99 5452 75 14** 

## Security notices

The connectors are designed for use in plant, control system and electrical equipment. The end user is responsible for checking whether the connectors are suitable for use in other applications.

Connectors with degree of protection IP 67 and IP 68 are not suitable for use under water. When used outdoors, the connectors must be separately protected against corrosion. For further information about IP degrees of protection refer to 'Technical support' in the Download Centre.

To lock the cable connector to the equipment connector, the threaded ring is tightened until it is 'finger-tight' (approx. 50 cNm).